						NO. 5 647		
pay:								
COMPIL	ZO:	.	CHE	cute:	(eer)	SHEET	OF	
TIPLE								1
				4				

TEST PROCEDURE, SET-1KA ()

THE FORM SPEC T

 			-	M	C	SF	PEC	:IF	FIC	Ä	TIC	ON							NO	. s	6	47			
REV:	T					T																			
COMPILED: CHECKED:									APPD:							SHEET OF									
TITLE:																									

A. INTRODUCTION

The SBT-1KA() is a general purpose radio transmitter providing AM, CW, and SSB operation throughout a frequency range of 2 to 32 MC. The transmitter provides 1kW output for AM and CW operation and 1kW PEP for sideband service.

B. MAIN COMPONENTS

The SBT-lKA() consists of eight separate units integrated to form the transmitter system. These components are:

- 1. Rack Assembly, RAK-9()
- 2. Auxiliary Power Panel, APP-4
- 3. High Voltage Power Supply, PS-5
- 4. Mid and Low Voltage Power Supply, PS-4A
- 5. Linear Power Amplifier, RFD-lA
- 6. Mode Selector, SBE-8 or 9
- 7. Variable Frequency Oscillator, VOX-5
- 8. Standing Wave Ratio Indicator, SWR-1K

C. TEST PROCEDURE

The test procedure for the SBT-lKA() system is outlined on the following pages. Before the system can be tested correctly, all components except the RAK-9 rack assembly must be tested and passed by the test department as per the specific test requirements for each unit.

- 1. 52 ohm load, lKW dissipation.
- 2. AC power cables.
- 3. Test equipment rack TMC Model PTE.
- 4. RF output cable, RG-8/U.
- 5. MWC24(7)S3, cable insulated shielded, 5 ft.
- 6. CA-409 cable assembly, jumper, 6 in.
- 7. H.P. VTVM, Model 410B, or equivalent.
- 8. Test cable assembly #106.
- 9. Test chart, SBT-1KA().
- 10. Voltmeter, Simpson 260 or equivalent.

II. PROCEDURE

- 1. Install AC input power cable from J601 of RAK-9 to AC line.
- 2. Connect Fanning strips of test cables assembly to E501 and E502 on rear of APP-4 chassis.

THE F RM SPEC 1

	TMC SPECIFICATION															NO. S			647									
REV:																						Ì						
COMPIL	COMPILED: CHECKED:									APPD: SHEET OF								OF										
TITLE:																												

- 3. Connect shielded lead from output of TTG mounted in test equipment rack PTE to CHANNEL 1 and CHANNEL 2 input terminals on test cable assembly.
- 4. Connect dummy load MONITOR OUTPUT to SIGNAL INPUT jack of PTE analyzer.
- 5. Connect jumper from terminal 5 on test cable terminal board T601 to terminal 8. This completes external interlock circuit.
- 6. Connect a jumper from terminal 21, T602 to terminal 22. This completes the KEY LINE to the SBE.
- 7. Set MAIN POWER switch on APP-4 to ON position. The red MAIN POWER indicator lamp should light.
- 8. Set MAIN POWER switch on PS-4A to ON position. The green MAIN POWER indicator lamp should light and RFD-1() blower and PS-5 fan should start running. NOTE:

PS_4A TRANSMITTER VOLTAGES switch should be in STANDBY position; FINAL VOLTAGES switch in OFF position and OVERLOAD breakers in ON position. Adjust line voltage to 115 volts, rack fan should start running.

- 9. Turn on POWER switch on SBE. The red lamp on power supply and OVEN lamp should light.
- 10. Turn on POWER switch on VOX. The red MAIN POWER lamp and INNER OVEN and OUTER OVEN lamps should light.
- 11. After a warm-up time of approximately 5 minutes, set the TRANSMITTER VOLTAGES switch to ON position. The red indicator lamp should light. Set TRANSMITTER VOLTAGES switch to STANDBY position.
- 12. **Set XMTR** switch on SBE to ON position. The TRANSMITTER VOLTAGES red indicator lamp on PS-4 should light.
- 13. Turn VOX METER switch to HFO position.
- 14. Set VOX HFO switch to ON position.
- 15. Set VOX MASTER OSCILLATOR FREQUENCY. (See chart, P.5)
- 16. With SBE, MF, XTAL, SW, in the VMO position, adjust the SBE for two tone test at req. output frequency using the TTG supplied with the PTE test equipment rack.
- 17. Set SBE OUTPUT control to zero.
- 18. Set FINAL VOLTAGES switch on PS-4 to ON position, Red indicator should light.
- 19. Using the tuning chart, adjust the RFD-1 for 1KW, PEP at required frequency (225 VRMS across 52 ohms). The SWR should be adjusted for minimum standing wave ratios at test frequencies.
- 20. Adjust RFD-1 to obtain 40 db third order distortion at 1kW PEP.

***	TM	C SPEC	FICATIO	N	NO. S 647
REV:					
COMPILED:		CHECKED:	9.	APPD:	SHEET OF
TITLE:					
			-		

- 21. Adjust RFD-1 to obtain 1kW CW. (225 VRMS 52 ohms.)
- 22. Place voltmeter across terminals 3 and 4 of T601 to test cable. Meter should read 115 volts A.C. This is transmitter antenna relay voltage, and may vary + 10%.
- 23. With voltmeter connected as in (23) above, set XMTR switch and EXCITER switch on SBE to OFF position.
 - a. Voltmeter should read zero volts.
 - b. FINAL VOLTAGE and TRANSMITTER VOLTAGE indicators on PS-4 should go out.
- 24. Place a jumper across terminals 1 and 2 on T601. TRANS-MITTER VOLTAGES indicator should light. Remove jumper.
- 25. Place a jumper across terminal 9 and 10 on T601. TRANS-MITTER VOLTAGES, FINAL VOLTAGES and EXCITER ON indicators should light. Remove jumper.
- 26. Place on ohmmeter across terminal 24 and 25 on T602. The ohmmeter should read 10-1-+ 20% between 24 and 25, and between 23 and 24.