The State of the Control of the Cont	· · · · · · · · · · · · · · · · · · ·
C SPECIFICATION	No. s-1054
CHECKED: APPD	SHEET OF 19
Test of Mod 1 SBE 8,9,10	lulul
	CHECKED: APPD 97 Test of Mod 1 SBE 8,9,10

COMPLETE PRODUCTION TEST

INSTUCTIONS FOR

TMC MODEL SBE-8,9,10

TRANSMITTING MODE SELECTOR

TMC SPECIFICATION

REV: A NO. S-1054

COMPILED: FP CHECKED: APPD: SHEET 2 OF 19.

Title: Production Test of Model SBE-8, 9, 10

Typed by cms

TEST EQUIPMENT REQUIRED

Frequency Counter Hewlett Packard Model 524-c A.C. Voltmeter 314 Ballentine VTVM 410B Hewlett Packard Audio Generator Hewlett Packard " 200CD Oscilloscope 543 Tektronics Spectrum Analyzer PTE-3 TMC VTVM AV-3 Heath Kit TMC Type CR-27/U 2.000 MC Crystal TMC Type CR-27/U 4.000 MC Crystal TMC Type CR-27/U 2.250 MC Crystal TMC Type CR-27/U 4.250 MC Crystal

70 2 Watt Resistor

1 Megohm Resistor 1/2 Watt.

1M-8-64-AINS.

TMC SPECIFICATION

REV: A NO. S_1054

COMPILED: FP CHECKED: APPD: SHEET 3 OF 19

TITLE: PRODUCTION TEST OF MODEL SBE-8, 9, 10

Typed by cms

*A. PRELIMINARY:

- 1. Inspect the unit for mechanical imperfections, proper type and placement of filters, vacuum tubes/ and obvious wiring errors. Attach jumper to terminals 2 & 3 of E-101.
- 2. Check the oven heaters by measuring the resistance between pins D and E of J-109. For 115 V AC connections this value should be 300 + 10%; for 230 V AC connections 600 + 10%.
- 3. Check ALDC circuitry as follows: From J113 to ground (chassis) reading should be 470 K + 10%; From J113 to pins 2 and 7 of V113 reading should be 23K + T0% in each case.
- 4. Check to insure that the RF and MF dial calibration marks line up with the Red line at the counterclockwise dial stop.
- 5. Connect the 70 load to the RF Output connector J-103.
- 6. Place test crystals in the oven as follows:

Position	Frequency
1.	2.0 mc
2.	4.0 mc
3.	2.25 mc
4.	4.25 mc

- 7. Connect the unit to the power supply and apply AC power. The Owen and Dial lamps should light up. After a brief warmup period, when oven lamp commences to cycle ON and OFF, proceed with the tests below.
- 8. With the Meter Switch in the CAL position, adjust the CAL potentiometer for ZERO reading of Meter M-101.
- *B. 250 Kes Oscillator Check
 - With the VTVM check the output voltage of the 250 Kcs oscillator at Pin 8 of Z103. The reading should be between .8 and 1.2 volts.

NOTE: Indicate completion and acceptance of portion (s) of this test preceded by (*) by recording required observed value or by check (/) mark as required on attach d t st Data Sheets.

1M-8,64-AINS

TMC SPECI	NO. S-1054				
REV: A					
COMPILED: FP CHECKED: 2	APPD:	SHEET 4 OF 19			
TITLE: PRODUCTION TEST OF MODEL	9, 10				

2. With the Frequency Counter check the frequency of the 250 kcs oscillator at Pin 8 of 2103. Adjust C-210 if necessary to obtain 250 kcs ± 3 cps.

*C. Modulator Tests

- *1. Tuning T-125 and 250 kcs Carrier Balance, LSB.
 - a. Place the Output Tuning Bandswitch to 4-8 mc band, LSB selector switch to CHAN 1, and all other channel controls to minimum or off.
 - b. Connect the AF generator to terminals 6 and 8 of E-101, Channel 1, for balanced line operation. To minimize unwanted pick up use twisted shielded pair with the shield grounded to terminal 7 thence by jumper to terminal 5.
 - c. Adjust the AF generator frequency for approximately mid point of the audio bandpass, 3575 cps at .05 volt output.
 - d. Connect the Ballentine VM to the Output terminals of Z-110 and adjust LSB Gain control for a 10 db deflection on the .1 volt scale. Adjust the top and bottom tuning slugs of T-125 for maximum deflection.
 - e. Turn OFF the AF generator and adjust R-265, Carrier Balance, for minimum deflection of the VM across the output of Z-110.
- *2. Tuning T-126 and 250 kcs Carrier Balance, USB.
 - a. Repeat the above tests for T-126 for the USB Z-111 filter and Carrier Balance control R-266.

*3. Tuning T-127

- a. With the AF generator disconnected from the unit, MF XTAL switch in VMO position connect the Ballentine VM to Pin 2 or 7 of V-113, MF Modulator, insert full carrier with the Carrier Insert control R-263.
- b. Tune top and bottom slugs of T-127 for maximum indication on the Ballentine VM.

NOTE: Indicate completion and acceptance of portion (s) of this test preceded by (*) by r cording required obs rved value or by check () mark as required on attached t st Data Sheets.

TMC SPECIFICATION						No. s-1054															
REV: A	t																			T	
COMPILED	: 1	FP			СІ	HEC	KED:	0	24	2	- /	APPD	:			SHEE	T	5	OF	19	•
TITLE:	PR	ODU	CTIC	ר אכ	EST	OF	MOE	DEL S	SBE-	8, 9	9, 10)									

c. Repeat with reduced carrier to insure sharp tuning indication on meter.

*D. Audio & Sideband Reversal Test.

*1. Microphone Input.

- a. Connect the AF generator unbalanced output in series with 1 megohm resister to Pin 1 of Mike Input jack and thence to ground, Pin 2.
- b. Set the USB and LSB Selector switches to OFF and Carrier Insert to minimum.
- c. Set RF Bandswitch to any position except 2-4 mes.
- d. Turn LSB Selector switch to Mike position. With the AF generator set to 1000 cps and an output of .05 volt, adjust the LSB Gain control for a deflection of 100% on LSB meter position. This point on the gain control should be reached before its maximum gain position.
- e. Connect the VTVM across the Output terminals of LSB filter Z-110 on the 0-1 volt scale. Note output indication and turn RF Randswitch to the 2-4 mcs bandwishe output indication should now be transferred from the LSB filter Z-110 to the output of the USB filter Z-111.

NOTE: The meter on the SBE unit will read the USB and LSB levels in the indicated meter switch positions only on bands 2, 3, and 4. On band 1, where sideband reversal occurs, the meter will indicate the opposite sid band level.

*2. Channel 1 Input.

- a. Connect the AF generator balanced output to terminals 6 and 8 of E-101 with a twisted shielded pair and shield connected to terminal 7 thence by jumper to terminal 5, ground.
- b. Set USB and LSB selector switches to OFF and Carrier Insert to MINIMUM.
- c. Set RF Bandswitch to any position except 2-4 mcs.
- d. Turn LSB Selector switch to Channel 1 position. With the AF gen rator set to 1000 cps and an output of .05 volt, as m asured

NOTE: Indicate c mpletion and acceptance of portions(s) of this test preceded by (*) by recording r quired obs rved value or by check (*) mark as required on attached Test Data Sh ts.

TMC SPECIFICAT	NO. S_1054					
REV: A						
COMPILED: FP CHECKED:	APPD:	SHEET 6 OF 19				
TITLE: PRODUCTION TEST OF MODEL SBE-8, 9	, 10					
Typed by mtp 12/14/65						

across one side of the AF generator balanced output and ground. Adjust the LSB GAIN control for a deflection of 100% on the LSB meter position. This point on the gain control should be reached before its maximum gain position.

e. Connect the VTVM across the output terminals of LSB filter Z110 on the 0-1 volt scale. Note output indication and turn RF bandswitch to the 2-4 mcs band. The output indication should now be transferred from the LSB filter Z110 to the output of the USB filter Z111.

*3. Channel 2 Input.

- a. Connect the AF generator balanced output to terminals 10 and 12 of E-101 with a twisted shielded pair and shield connected to terminal 11 thence by jumper to terminal 9, ground.
- b. Repeat the tests for paragraphs b thru e of Channel 1 Input above, with the exception that USB should be substituted for LSB and vice versa, Z110 for Z111 and vice versa. Requirements remain as for Channel 1 Input above.

*E. VOX Tests:

*1. Gain

- a. Set VOX gain R-140 to maximum.
- b. All other gain controls to minimum.
- c. Increase Carrier Insertion R-263 until the Exciter Lamp T-101 lights and relay K-101 operates, as evidenced by ZERO resistance reading from Pin 4 of E-101 to ground.
- d. With the VTVM on Pin 2 of VIIO, a reading of .17 to .5 volt should be obtained.
- e. With the Carrier Insertion R-263 reduced to minimum, the Exciter Lamp and Relay K-101 should de-energize as indicated by infinite resistance from terminal 4 of E101 to ground.
- f. Set the Transmitter switch S-104 to ON, the resistance reading from terminal 4 to ground of K-101 should again be ZERO.

NOTE: Indicate c mpletion and acceptance of portion(s) of this test preceded by (*) by recording requir d obs rved value or by check (*) mark as required on attach d Test Data Sh ets.

M. S.D.F.C. 1

TMC SPECIFICATION	NO. S-1054				
REV: A CHECKED:	APPD:	SHEET 7 OF 19			
TITLE: PRODUCTION TEST OF MODEL SBE-8, 9, 1 Typed by mtp 12/14/65	0				

- *2. Squelch Test and Push-to-Talk
 - a. Set VOX GAIN R-140 to maximum.
 - b. All other gain controls to minimum.
 - c. Increase Carrier Insertion R-263 until Exciter Lamp lights.
 - d. Place Squelch Gain R-129 to maximum.
 - e. Connect AF generator unbalanced output to Terminals 13 and 14 of E-101. With the generator set to 1000 cps, adjust its output until the Exciter Lamp extinguishes.
 - f. With the VTVM measure the voltage at Pin 9 of V110. It should be between .5 to 1.5 volts.
 - g. To simulate closing of the Push-to-Talk circuit, short t rminal 1 of E-101 to ground. The Exciter Lamp should light and relay K-101 should operate. Repeat on Terminal 3 of E-101.
 - h. Return VOX GAIN and Squelch controls to minimum.

*F. M.F. Alignment-Injection-Carrier Balance

- *1. Mid-frequency Alignment
 - a. At the mixer grid of V-113 there may appear two frequencies; a 250 KC frequency (carrier inserted) and a VMO injecti n frequency. At the band extremes, the following table applies:

XTAL OR VMO	DIAL READING	LF	RESULTING FREQ.
2000 KC	2.0 MC	250 KC	1.75 MC
4000 KC	4.0 MC	250 KC	3.75 MC

- b. The MID-FREQUENCY is aligned so that the proper product is chosen when the dial is set to the VMO or XTAL frequency; that is, when a 2000 KC crystal is injected, the MF dial is set to 2.0 MC, but the actual frequency is 1.75 MC which is the difference between the 2000 KC crystal and the 250 KC LF. With this in mind, preliminary alignment may be accomplished by using the 2000 KC and 4000 KC crystals (or VMO).
- c. Before aligning the MF. see that the tuning capacitors are in full mesh when the dial is set to the marker on the MF dial.

NOTE: Indicate completion and acceptance f portion(s) of this t st preceded by (*) by r c rding requir d observ d value or by check (*) mark as required n attach d T st Data Sheets.

TMC FORM SPEC 1

TMC SPECIFICATI	ON	NO. S-1054	
IMC SPECIFICATI			
REV: A	APPD:	SHEET 8	OF 19
COMPILED: CHECKED:		1	
TITLE: PRODUCTION TEST OF MODEL SBE-8, 9,	10		· · · · · · · · · · · · · · · · · · ·
typed by mtp 12/14/65			

- d. Remove P107 from J110 on Z107. Connect VTVM to Pin 2 of Z107. Unbalance injection with R130, MF Balance Control.
- e. Select crystal position 1 (2000 KC). Set MF dial to 2.25 MC. Tune T109 and T110 for maximum output.
- f. Select crystal position 2 (4000 KC). Set MF dial to 4.25 MC. Tune trimmers C140 and C141 for maximum output.
- g. This preliminary alignment will ensure subsequent selection of the proper mixer product on the MF dial.

*2. Carrier Balance

- a. Select crystal position 1 (2000 KC).
- b. MF dial to 2.25 MC.
- c. Carrier Insert CCW, adjust R130 for minimum carrier as indicated by observing Meter in MF position. Lock R130. Reconnect P107 to J110.
- d. Insert full carrier. Select crystal position 1 (2000 KC). Set MF dial to 2.0 MC. Tune T109 and T110 for maximum output. Select crystal position 2 (4000 KC). Set MF dial to 4.0 MC. Tune C140 and C141 for maximum output. In each case, reduce the carrier to insure that proper mixer product has been selected. Repeat until band is tracked. Lock slugs with spintite tool.

*3. Crystal and VMO Injection Check

- a. Connect the VOX-5 output from the PTE analyzer to VMO input J104. Maintain a .1 on VOX-5 output meter level for all subsequent tests.
- *b. Connect the RF voltmeter at the junction of C163 and C164, and measure the voltages under conditions indicated b low:

S-107 POSITION	FREQUENCY	MIN. VOLTAGE LIMIT
1	2.0 MC	1.5 V
2	4.0 MC	.6 V
VMO	2.0 MC	1.5 V
VMO	4.0 MC	.6 V

NOTE: Indicate completion and acceptance of portion(s) of this test preceded by (*) by recording r quired observed value or by check (*) mark as required on attached T st Data She ts.

TMC SPECIFICA	TION No. s-1054	
REV: A		
COMPILED: FP CHECKED:	APPD:	OF 19
TITLE: PRODUCTION TEST OF MODEL SBE-8,	9, 10	
Typ d by mtp 12/14/65		

*G. R.F. Circuits Alignment

- *1. HF Oscillator and Multiplier Alignment.
 - a. Remove lead from J108 and insert test cable (see attached dwg.). Connect clips to RF VTVM.
 - b. All controls except POWER ON and EXCITER ON switches in OFF position or MINIMUM.
 - c. Adjust L101 through L114 for 2 volts indication on RF VTVM at the corresponding "Injection" frequency shown below.
 - d. Remove VTVM and substitute frequency counter.
 - e. Adjust proper capacitor for the correct frequency as indicated by the frequency counter for the frequencies shown in "Injection" column below.
 - f. Repeat above until frequency and output voltages are correct. Reconnect P105 to J108.

BAND MC POS.	XTAL F. (MC)	INJECT F. (MC)	ADJUST	MENTS	REMARKS
4	8	8	C285	L101	When adjusting coil
5	10	10	C286	L102	slugs L101 thru L114
6	12	12	C287	L103	turn slug all th
7	14	14	C233	L104	way out and adjust
8	8	16	C234	L105	on the first 2V peak
9	18	18	C235	L106	indication.
10	10	20	C236	L107	
11	11	22	C237	L108	
12	12	24	C238	L109	
13	13	26	C239	L110	
14	14	28	C240	L111	
15	10	30	C288	L112	
16	8	32	C289	L113	
17	17	34	C290	L114	

- 2. Preliminary RF Amplifier Alignment
 - a. Before alignment, check full meshing of capacitors C181 against dial marking at low frequency end of dial.
 - b. Channel 1 and 2 selector switches OFF.
 - c. XTAL Switch Position 1 (2000 MC), Carri r Insert s t for maximum CW.

NOTE: Indicat completion and acceptance of portion(s) f this test preceded by (*) by recording required observed valu or by check (*) mark as required on attached lest Data Sheet.

TM	NO. S-1054				
REV: A					
COMPILED: FP	CHECKED:	APPD:	SHEET 10	OF 19	
TITLE: PRODUCTION	N TEST OF SBE-8, 9, 10				
Typed by vab	12/14/65				

- d. MF tuning tuned to 2 MC. Meter in MF Position.
- e. RF output terminated in 70 1 load.
- f. R.F. Voltmeter across 70-1 load.
- g. In subsequent RF alignment tests the drive should be sufficiently low to preclude broad response meter indications.
- 3. 1.75-4 MC Band Alignment.
 - a. Output Tuning Bandswitch 1.75-4 MC Band.
 - b. Band MC Switch to Band O. MF Tunjng tuned to 2 MC. Meter in MF position.
 - c. RF Tuning tuned to 1.75 MC, Meter switch in RF position.
 - d. Tune T-116 and T-120 for maximum output.
 - e. XTAL Switch position 4 (4.250 MC), carrier inserted and MF Tuning tuned to 4.250 MC on meter in MF position.
 - f. RF Tuning tuned to 4 MC, meter switch in RF position.
 - g. Peak C-191 and C-179 for maximum output on VTVM.
 - h. Repeat above steps with reduced drive to insure proper band alignment, and sharp tuning peaks.

4. 4-8 MC Band.

- a. Output tuning bandswitch to 4-8 MC Band.
- b. XTAL Switch position 4 (4.250 MC)
- c. Tune MF to 4.250 MC, Meter in MF Position.
- d. Output tuning tuned to 4 MC, Meter in RF Position.
- e. Tune T-113, T-117 and T-121 for maximum output.
- f. Carrier Insert CCW, minimum carrier.
- g. MF XTAL Switch to VMO position (remains in this position for subsequent RF Band Alignments)
- h. Band MC Switch in Band 4 (8 MC).

NOTE: Indicate completion and acceptance of potions(s) of this test precedd by (*) by recording r quir d obs rv d value or by check (mark as r quir d on attached t st Data Sheets.

TN	AC SPECIFICA	TION	NO. S-1054
REV: Δ			
COMPILED: FP	CHECKED:	APPD:	SHEET 11 OF 19
TITLE: PRODUCTION	TEST OF SBE-8, 9, 10		
Typed by val	12/14/65	_	

- i. Output Tuning tuned to 8 MC.
- j. Peak capacitors C-203, C-192 and C-180 for maximum output.
- k. Repeat above procedure to insure proper band alignment with reduced drive to insure sharp tuning peaks.

5. 8-16 MC Band.

- a. Output Tuning Bandswitch to 8-16 MC Band.
- b. Output Tuning tuned to 8 MC.
- c. Band MC Switch in Band 4 (8 MC)
- d. Tune T-115, T-119 and T-122 for maximum output.
- e. Band MC Switch to band 8 (16 MC)
- f. Output Tuning tuned to 16 MC. Meter switch in RF position.
- g. Peak capacitors C-202, C-190 and C-178 for maximum output.
- h. Repeat above procedure to insure proper band alignment with reduced drive to insure sharp tuning peaks.

6. 16-32 MC Band.

- a. Output Tuning Bandswitch to 16-32 Band.
- b. Output Tuning tuned to 16 MC.
- c. Band MC Switch in Band 8 (16 MC)
- d. Tune T-114, T-118 and T-112 for maximum output.
- e. Band MC Switch to Band 16 (32 MC)
- f. Output Tuning tuned to 32 MC, and RF Meter Switch to RF output position.
- g. Peak capacitors C-201, C-189 and C-177 for maximum output.
- h. Repeat above proc dure to insure proper band alignment with reduced drive to insure sharp tuning peaks.

	TM	NO. S-1054					
REV: A							
COMPILED:	fP	CHECKED:	APPD:		SHEET 12	OF	19
TITLE: 1	PRODUCTION TE	ST OF SBE-8, 9, 10				. <u></u>	
	Typed by vab	12/14/65					

- 7. Output Voltages and HF Carrier Balance
 - a. Carrier insert CCW, minimum.
 - b. Band MC Switch to Position 0, RF tuning tuned to 18 MC.
 - c. RF Output Control set for mid scale reading on meter in RF position.
 - d. Balance R-105 and C-308 of Z107 for minimum indication on RF output meter.
 - e. Band MC Switch to band 0.
 - f. Set XTAL selector switch to position 3 (2.250 MC)
 - g. With carrier inserted, tune MF to 2.250 MC as indicated on Meter in MF Position.
 - *h. Audio generator connected to terminals 6-8 of E101 carrier insert CCW. LSB or USB gain set for 100% on MF meter.
 - i. Set m bandswitch to 2-4 MC range. Tune output amplifier to 2 MC.
 - j. Check for 10.V minimum across 70 1 load.
 - k. The shove Output Voltage test procedure must be repeated in two (2) megacycles increments from 2 through 32 MC, each time checking that a minimum 10 volt RF output is obtained across the 70 J- load.
 - 1. When performing above tests insure dial calibration is correct.

H. OVERALL TESTS & REQUIREMENTS

- *1. Power Output & Signal to Distortion Test
 - a. This test will be made on one frequency selected at random in each one of the four RF Bands, note sheet 18 of 18, Data Sheet.

NOTE: Indicate completion and acceptance of portion(s) of this test preceded by (*) by recording r quired bserved value or by check (*) mark as required on attached test Data Sheet.

TMC FORM SPEC 1

	TMO	NO. S-1054		
REV: A				
COMPILED:	FP	CHECKED:	APPD:	SHEET 13 OF 19
TITLE: i	PRODUCTION TE	ST OF SBE-8, 9, 10	0	
•	Typed by vab	12/14/65		

- b. Connect the two AF test tones from the PTE analyzer with a twisted shielded pair to Channel 1 input, terminals 6 and 8 of E-101 with the shield connected to the terminals 7 and 5. Connect the analyzer RF input to the 70 \mathbb{P} load.
- c. With the USB selector set to Channel 1 and USB gain set not to exceed 100 on Meter in MF position, tune to unit to the selected output frequency for an output of 4.2 RF volts across the 70-1 load.
- d. Setup and adjust PTE as follows to measure the S/D in the USB-
 - (a) Gain fully clockwise.
 - (b) Amplitude scale switch to LOG.
 - (c) CAL OSC to OFF.
- e. IF attenuator to 20 db position.
- f. Sweep selector to 14 KC.
- g. AFC ot OFF.
- h. The VOX-5 in the PTE should be adjusted for a frequency 500 KC higher than the signal frequency to be displayed. The two tone test signal should be set to the center of analyzer.
- i. Adjust input attenuator switches so that two tone test signal peaks are as possible to the 0 line or slightly above. With the gain control set these peaks to the 0 line on the analyzer.
- j. Place IF attenuator switch to 0 position thus expanding the 0 to 40 db scale to 0 to 60. Note the odd order distortion products.

REQUIREMENT: The S/D must be at least 45db below either tone of a standard two tone test for 1/4 watt PEP as viewed on PTE Panalyzer.

k. Test meter on SBE by setting Meter switch to MF position set meter reading to 100 with USB gain control. Switch to LSB and the USB positions. Meter sh uld r main approximatelt 100 + 1/2 division. Ch ck RF p sition by setting output to 5 volts. M ter should read 100 + 1/2 division. Return output to 4.2 volts.

TMC SPECIFICAT	NO. S-1054	
REV: A REV		
COMPILED: CHECKED:	APPD:	SHEET 14 OF 19
TITLE: PRODUCTION TEST OF MODEL SBE-8, 9	, 10	
Typed by cms		

*2. Carrier Suppression.

- a. This test will be performed on the same frequencies as the test in paragraph 1 above and with the same general PTE setup.
- b. Turn USB and LSB switches to OFF, no AF input.
- c. Tune the unit to the desired frequency with carrier insert drive for watt PEP output. Carrier presentation in center of anlyzer and peak adjusted to the 0 line with IF 20 db attenuator IN.
- *d. Set IF attenuator switch to 0 and place carrier Insert fully CCW, carrier drive at minimum. Note level of the remaining carrier on anlyzer.

REQUIREMENT: Maximum carrier suppression must be at least 55 db below the test signal at 1/4 Watt PEP.

*3. Unwanted Sideband Rejection.

- a. This test will be performed on the same frequencies as the test in Paragraph 1 above and with the same general PTE setup.
- b. Connect 500 AF to terminals 6 & 8 of E-101, USB Channel 1 adjusted for -6 db and unit tuned to desired frequency for 1/4 Watt PEP. PTE sweep at 14 Kc adjust presentation of 500 tone signal to 0 line on anlyzer with IF 20 db attenuator in.
- c. Set LSB to Channel 1. This will provide a dual 500 tone signal presentation. Note position of the LSB 500 tone signal and then place LSB to OFF.
- *d. Set IF 20 db attenuator to 0 and read the level of the 500 tone appearing as an unwanted signal in the LSB.
- e. Repeat the above test for the LSB.

REQUIREMENT: Unwanted Sideband rejection shall b at least 60 db below 500 tone test signal for 1/4 Watt PEP, both USB and LSB.

NOTE: Indicate completion and acceptance of portion(s) of this test preceded by (*) by recording required obs rv d valu or by check (
mark as requir d on attached test Data Sheets.

EC 1

	TN	NO. S.		, , , , , , , , , , , , , , , , , , , ,					
REV:									
COMPILED:		CHECKED:	APPD:		SHEET	15	OF	19	
TITLE:	PRODUCTION	TEST OF MODEL SBE	-8, 9, 10		 				
Typed	by cms					_ ··			

- *4. 2nd Harmonic Suppression.
 - a. This test will be performed on frequency in the 4-8 mc band.
 - b. Set both LSB and USB OFF and tune the unit with carrier drive to 1/4 Watt PEP output at the 2nd Harmonic of the fundamental frequency to be measured. (Example:-If desired frequency to be measured is 4 MC, the unit would be tuned to 8 MC.)
 - c. Adjust presentation on PTE with IF 20 db attenuator IN and signal peak on 0 line. Leave all PTE controls at their present settings.
 - d. Tune the unit to the fundamental frequency at the same output as above.
 - 'e. Set the IF 20 db attenuator to 0. The 2nd harmonic component will now be presented on the analyzer. Note the level of this 2nd harmonic signal.

REQUIREMENT: The 2nd harmonic shall be at least 40 db below the level of the fundamental frequency at 1/4 Watt PEP output.

- *5. Overall Frequency Response Test.
 - a. Setup AF generator to approximately the center fr quency of the bandpass spectrum at .05V output connected to terminals 6 and 8 of E-101., with shielded twisted pair, shield connected to 7 and 5. Monitor AF Generator output with Heath Kit AV-3 VTVM. Output should be constant.
 - b. With MF XTAL Switch in position 4, and using LSB, tune unit to 4 MC output frequency with USB OFF and carrier insert at minimum.
 - c. Connect Ballantine VTVM across the 70 load.
 - d. Advance LSB gain control to -6db and adjust RF Output for center scale reading on Ballantine.

NOTE: Indicate completion and acceptance of portion(s) of this test preceded by (*) by recording required observed value or by check (/) mark as required on attached test Data Sheets.

TMC FORM SPEC 1

7		NO. S-1054						
REV: A	MC SPECIFIC							
COMPILED:	CHECKED:	APPD:		SHEET 16	OF	19		
TITLE: PRODUCTION TEST OF MODEL SBE-8, 9, 10								
Typed by cms						·····		

- e. Maintaining constant output from the AF generator vary the frequency from SBE-8 250 NJ to 3500 N, SBE-9 250 NJ to 7500 N, SBE-10 250 NJ to 6000 NJ, moting the maximum and minimum RF output readings across the 70 No load.
- f. Repeat above test for the USB with AF generator c nnected to terminals 10 and 12 on E-101 with the ground shield tied to terminals 11 and 14.

REQUIREMENT: The difference between the maximum and minimum readings in step 5 above shall not exceed 3 + 1.5 db for LSB and USB.


*6. True AM (phase shift adjustment).

Apply Input from AF generator as in previous test. Turn both USB and LSB switches on. Connect escilloscope proceed to 70 A load. Adjust gain controls of USB and LSB for -20 db readings on the SBE meter in the USB and LSB Meter Switch positions.

Adjust oscilloscope for the following waveform.



Increase carrier level from zero and adjust R280 (on audio chassis) until the following true AM signal is observed on oscilloscope.

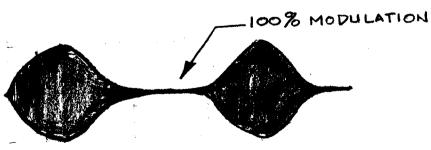


Record meter reading in MF position in DB.

NOTE: Indicate completion and acceptance of portion(s) of this test preceded by (*) by recording required observed value or by check (v) mark as required on attach d test Data Sheets.

1M.8,64-AINS.

				TM	CS	PE	CIF	FIC	A	ΓΙΟ	NC				.,		NO. S	-105	14		
REV:	A																				
COMP	ILED:	F			CHECK	ED:	E. S	Mark .			APPE): 					SHEET	1:	7	OF	_19_
TITL	E:		P	OBUC	TION T	<u>rest</u>	OF	MODE	EL S	SBE -	8, 9	, 10)		_						
•	Typed	by	cms					TES1	Γ DA	ATA	SHEE	T									
		l.	(A-1	thru	8) P:	reli	mina	ry o	chec	cks	& te	sts	com	ple	t e d					_ (1
		2.	(B)	250	Kc Os	c. C	heck	S												 v,	
		- •						(1			put \ quenc		ige	•			Kc •				
	;	3.	(3)	Modu	lator	Tes	ts														
				(2)	Tunin Tunin Tunin	g T-	126	& US	SB (Car										— (·	
		4.	(D)	Audi	o & S	i de b	and	reve	ersa	al											
				(2)	Micro Chann Chann	el l	inp	out o	com	ple	ted										イ イ オ
		5.	(E)	vox	Tests																
					Gain Squel								ecke	d						_ (ろ
	(6.	(F)	MF A	lignm	ent															
				(2)	thru Carri Crys VMO	er B tal	alar inje	cti	com on :	ple at	ted	(a th	V.at	4.	MC						イイ
		7.	(G)	RF C	ircui	ts A	ligr	men	t												
					HF OS Outpu obtai	t vo	ltag	ges	acr								es —				(
			1.75	MC			v.		14	MC_			V	7.	2	6 M	c			٧.	
			4 MC				v.		16	MC_			\	7.	2	8 M	c	,		_v.	
			6 MC				_V.		18	MC			\	/ .	3	0 M	c			_v,	
			8 MC				٧.		20	MC			\	7.	3	2 M	c			_v.	
			10 MC			V	- /.		22	MC				/ .							
			12 MC		·		/•		24					/ .							
					,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,		-			-											

	1 141.	C Sr	<u> 'EUII</u>	FICA	<u> 1017</u>	<u> </u>			NO.	s_1051	+
 											
LED:		CHECKE	D:	M	AF	PD:			SHE	ET 18	0
:	PRODUCTIO	N TEST	OF MOD	EL SBE	-8, 9,	10					
	<u> </u>	T	EST DAT	ra shee	T						
	(H) OVERA	L TES	TS & RE	OUIREN	ENTS						
		J	range (Marie and Marie Paris) and all departments of the second difference of the	AT 1/	e antero e societa de contrata	DED U	mpim	encinal and the series of majors		*** ****	
	BAND SW	FOUT	MADI	: A1 1/	T	CAR	UNW	SEC	OND		
	POS.	(mcs)	S/D I	RATIO		SUP		SB. REJ.		HARM	
		`	USB	LSB	đb		USB	LSB	RE.	J.	
	1.75-			AND ALLEY OF A PER A CONTRACTOR			1			M)	1
	4 mcs				 		}		12/12	<u> </u>	4
	4-8 mcs	1		1			4				1
		and the second second second second					1		1111		7
	8-16 "			+	-	1///	J				
	16-32 '	ł			Ì		4				4
			a wall the history and the same of the sam	1		Town of the	1	1	1		1
	POWER OUT	LIGHT COMPANIES		- DED		- Market Mid	70	~ 100	d with	121	_' / DF
	DIMED INTI	J111 • 1	/A Wat	t PEP (7.2	
	*OWEN OOM		.,		DCSIN	Ju acro		104	u with		
	REQUIREMEN		., +		DUAIN	ou acro		104	u with		
	REQUIREMEN	NTS:									
	REQUIREMEN	NTS: S/D at	least	45 db l att PEI	oelow (either	tone	of a t	wo ton	e test	
	REQUIREMEN a. S	NTS: S/D at signal Maximum	least at ½/w Carri	45 db l att PEI er Supj	oelow o	either	tone	of a t	wo ton	e test	
	REQUIREMEN a. S b. !	NTS: S/D at signal Maximum signal	least at ½/w Carri at ½w	45 db 1 att PEI er Supj att PEI	pelow (pressi	either	tone	of a t 55 db	wo ton below	e test	ŧ
	REQUIREMENT S.	NTS: S/D at signal Maximum signal Unwante tone te	least at ½ w Carri at ¼ w ed Side	45 db latt PEI er Supi att PEI band Ro	oelow (). Oressic). Ofection	either on at 1 on at 1	tone	of a t 55 db 60 db	wo ton below below	e test the 500 A	ŧ
	REQUIREMENT a. S b. I c. I	NTS: S/D at signal Maximum signal Unwante tone te	least at ½ was Carriat ¼ wed Side est sig	45 db l att PEI er Supp att PEI band Ro nal 4 v	pelow of the period of the per	either on at l on at l EP. least	tone	of a t 55 db 60 db	wo ton below below	e test the 500 A	ŧ
	REQUIREMENT a. S b. S c. S d. S	NTS: S/D at signal Maximum signal Unwante tone te 2nd Hantest si	least at ½ w a Carriat ¼ wed Side est sigrmonic ignal a	45 db l att PEI er Supj att PEI band Ro nal 量 v Reject t 量 wa	pelow of the period of the per	either on at l on at l EP. least	tone east east 40 db	of a t 55 db 60 db .below	wo ton below below two t	e test the 500 A	ŧ
	REQUIREMENT a. S b. S c. S d. S	NTS: S/D at signal Maximum signal Unwante tone te 2nd Hantest si	least at ½ w a Carri at ¼ ed Side est sig cmonic ignal a	45 db latt PEI er Suppatt PEI band Re nal 4 valect t 4 war ency Re	pelow of the period of the per	either on at l on at l EP. least	tone east east 40 db	of a t 55 db 60 db .below	wo ton below below two t	e test the 500 A	ŧ
	REQUIREMENT a. S b. S c. S d. S	NTS: S/D at signal Maximum signal Unwante tone te 2nd Hartest si Overall	least at ½ w a Carri at ¼ w ed Side est sig rmonic ignal a l Frequ	45 db latt PEI er Suppatt PEI band Re nal 4 Reject t 4 wa ency Re flat w	pelow of the period of the per	either on at l on at l EP. least t from 3 db (4	tone east east 40 db	of a t 55 db 60 db below α 2 db).	wo ton below below two t	e test the 500 A	ŧ
	REQUIREMENT a. S b. S c. S d. S	NTS: S/D at signal Maximum signal Unwante tone te 2nd Har test si Overall Max	least at ½ w a Carri at ¼ ed Side est sig rmonic ignal a l Frequ c. outp	45 db latt PEI er Suppatt PEI band Re nal ¼ va Reject t ¼ wa ency Re flat w	pelow of the period of the per	either on at l EP. least e from 3 db (tone east east 40 db	of a t 55 db 60 db below v 2 db).	wo ton below below two t to	e test the 500 A	ŧ
	REQUIREMENT a. S b. S c. S d. S e. S	NTS: S/D at signal Maximum signal Unwante tone te 2nd Hartest si Overall Max	least at ½ w a Carri at ¼ ed Side est sig cmonic ignal a l Frequ c. outp	45 db latt PEI er Suppatt PEI band Re nal 4 valency Re flat wat ut (1 n (2	pelow of the second section at the second section at the second s	either on at l EP. least e from 3 db (tone east east 40 db	of a t 55 db 60 db below 2 db).	wo ton below two t to	e test the 500 A	ŧ
	REQUIREMENT a. S b. S d. S e. S f. S g.	NTS: S/D at signal Maximum signal Unwante tone te 2nd Hantest si Overall Max Va Phase :	least at ½ w a Carri at ¼ ed Side est sig rmonic ignal a l Frequ c. outp	45 db latt PEler Suppatt PEleband Reject tawa ency Reflat were taken tak	pelow of the period of the per	on at least from 3 db (tone east east 40 db	of a t 55 db 60 db below 2 db).	wo ton below below two t to	e test the 500 A	ŧ
	REQUIREMENT a. S b. S d. S e. S f. S g.	NTS: S/D at signal Maximum signal Unwante tone te 2nd Hantest si Overall Max Va Phase :	least at 4/w at 4/w at 4/w ed Side est sig cmonic ignal a l Frequ c. outp ariatio shift a	45 db latt PEler Suppatt PEleband Reject tawa ency Reflat were taken tak	pelow of the period of the per	either on at l EP. least e from 3 db (tone east east 40 db	of a t 55 db 60 db below 2 db).	wo ton below two t to	e test the 500 A	ŧ
	REQUIREMENT a. S b. S c. S d. S f. S	NTS: S/D at signal Maximum signal Unwante tone te 2nd Hantest si Overall Max Va Phase :	least at 4/w at 4/w at 4/w ed Side est sig cmonic ignal a l Frequ c. outp ariatio shift a	45 db latt PEler Suppatt PEleband Reject tawa ency Reflat were taken tak	pelow of the period of the per	on at lon at least the from 3 db (tone east east 40 db	of a t 55 db 60 db below 2 db).	wo ton below two t to	e test the 500 A	ŧ

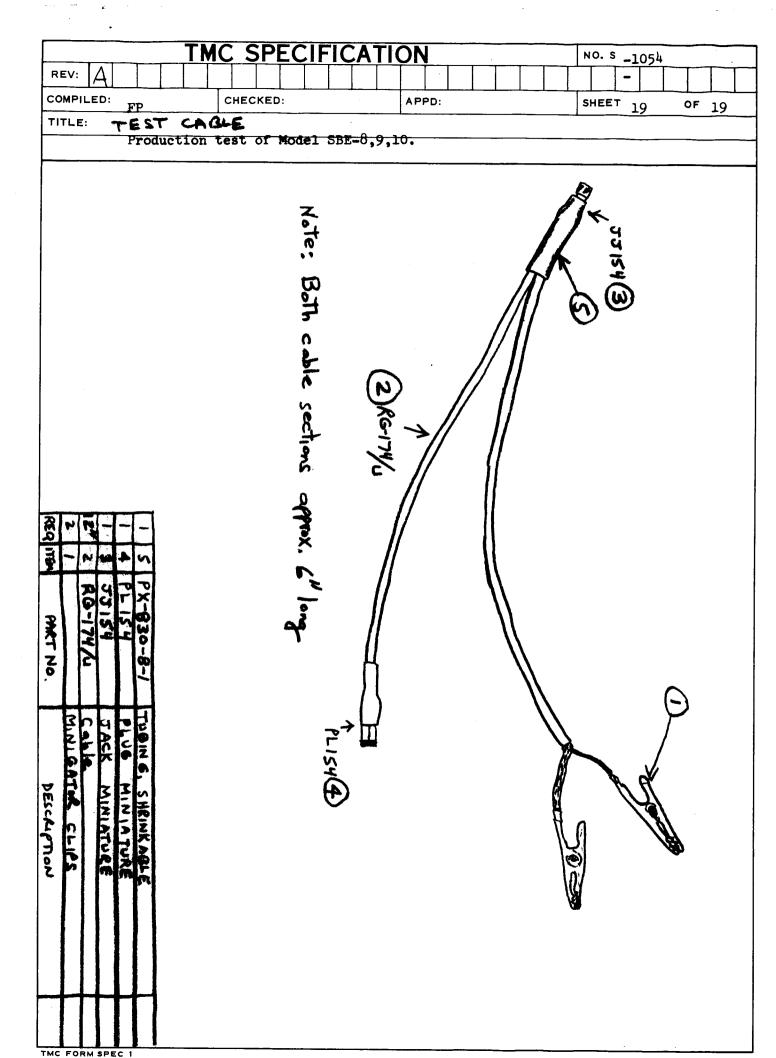

REVIS	ION	SHEET		THE TECHNICAL	MATERIEL CORP. NEW YORK	S \ 0 5 4		
				MAMARONLOR	DESCRIPTI		APP.	
DATE	REV.		EMN #			FOR PRODUCTION	d Qe	
16/66	\$	*	+			TOR (RODUCTION		
/21/66	A	16,18	15825	Revised per EMN			0	
								ĺ
								ĺ
								ĺ
	<u> </u>							ĺ
								ĺ
		_						l
			-					l
	!		 					١
	ļ		 					
	ļ							١
	ļ	·	ļ				 	۱
	ļ		<u> </u>				 	۱
			_					l
	l						 	1
							<u> </u>	1
							<u> </u>	-
	<u> </u>							-
							<u> </u>	-
	 							
	-	_						
	-							
	-							
_	+							_
	-			 				•
	 		-					-
								-
			_					-
			_				-	-
								-
							-	-
								_
							-	_
							_	_
H	+						l	