

# FIELD SERVICE NOTE

F/S/N Number Date 140-040303-0 1 OCT 1978

ATS-3 RETROFIT KIT

KIT-426

# FIELD SERVICE NOTE

F/S/N Number 140-040303-0 Date 1 OCT 1978

ATS-3 RETROFIT KIT

KIT-426

TMC SPECIFICATION		NO.			
REV:					
COMPILED:	CHECKED:	APPD:	SHEET	3	OF 12

#### PURPOSE:

TO UP-DATE THE (AUTOMATED ANTENNA TUNER) ATSA-3 THE FOLLOWING MOD-IFICATIONS MUST BE PERFORMED.
A, AX5175 (CONTROL)

# A4936 (A102/A104)

1. Printed circuit board A4936 REF CK2054-C, REF DRAWING A4936

CK2054 must be used to perform the electrical modifications on this printed circuit board.
The following components must be ADDED, DELETED or CHANGED.

ADD	R29	RCO7GF471J
	R30	RC07GF332J
	R31	RC07GF242J
	R32	RC07GF223J
	07	2N2222
	C15	CC131-48
	C16	CC131-48

Add a wire from the junction of R31 and R32 to the junction of R16 and R19.

Add a wire from C15 (2.2uf) to the junction of CR8 and R26. Add a wire from connector Pin (B) to the junction of CR8 and R26.

DELETE	C3	220uuf
	C9	220uuf
	C4	.01uf
	C11	470uuf
	R5	3.3K
	R13	1.5K
	R27	560 ohms


Delete at Z2, from Pin 5  $\overline{\text{R5}}$ , 3.3KDelete at Z2, from Pin 1  $\overline{\text{C4}}$ , 01ufDelete at Z1, from Pin 5  $\overline{\text{C9}}$ , 220uufDelete at Z1, from Pin 8  $\overline{\text{R13}}$ , 1.5KDelete at Z1, from Pin 1  $\overline{\text{C11}}$ , 470uufDelete at the junction of CR8 and R26, R27 560 ohms

## CHANGE

Change R26 from a 1K Resistor to RC07GF103J Change R9 from a 1K REsistor to RC07GF562J Change R28 from a 56 ohm Resistor to RC32GF101J Change Z1 from NW156 (UA709) to UA741 Change Z2 from NW156 (UA709) to UA741 Change R8 from a 47K Resistor to RC07GF823J

AX5175

(TOP VIEW)

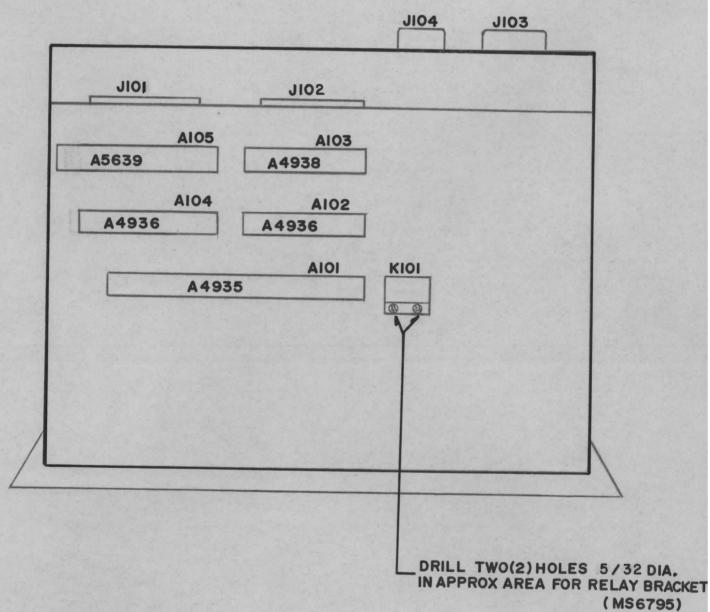

(MS6795)

	TMC SPECIFIC	CATION	NO.			
REV:				T		
COMPILED:	CHECKED:	APPD:	SHEET	1	OF	12
TITLE:		Carlo Company of the Company	Jonee		OF	12

# A5639 (A105)

2. Printed circuit board A5639 Ref. CK2128-A, Ref. Drawing A5639

Remove A4937 (A105) and replaced directly with A5639.

# A4935 (A101)

3. Printed circuit board A4935 Ref. CK2052-D, Ref. Drawing A4935

CK2052 must be used to perform the electrical modifications on this printed circuit board. The following components must be <code>DELETED</code> or <code>CHANGED</code>.

### DELETE

R20 1.5K R19 27K R18 5K R17 12K C7 .001uf C8 .001uf

Delete at Z1, from Pin 5  $\underline{C8}$ , .001 $\underline{uf}$  Delete at Z1, from Pin 1  $\underline{C7}$ , .001 $\underline{uf}$  Delete at Z1, from Pin 8  $\underline{R20}$ , 1.5 $\underline{K}$  Delete at Z1, from Pin 1  $\underline{R18}$ , 5 $\underline{K}$  (VAR) R19, 27 $\underline{K}$  Delete at Z1, form Pin 7  $\underline{R17}$ , 12 $\underline{K}$ 

#### CHANGE

Change Z1 from NW156 (UA709) to UA741

# A4938 (A103)

Printed circuit board A5639
 Ref. CK2055-D, Ref. Drawing A4938.

CK2055 must be used to perform the electrical modifications on this printed circuit board.
The following components must be ADDED, DELETED, or CHANGED.

ADD C17 CE105-50-25 CR14 1N645 R56 RC07GF105J

Add C17,(50uf at 25V) at the junction of Q11 (2) and R35 to the junction of Q11 (1) and CR4 Add CR14 (1N645) and R56 (1 meg) parallel at the junction of Q7

REV:	ON	NO.			
IVEA.			T		
COMPILED: CHECKED:	APPD:	SHEET	5	OF	12

and C6 to the junction of R43, and Q13 (3).

## DELETE

R14 1.5K C4 .001 uf R15 12K R51 5K (VAR) R16 27K C12 .001uf R25 250K (VAR)

Delete at Z2, from Pin 5 C12 .001uf Delete at Z2, from Pin 8  $\overline{R14}$  1.5K Delete at Z2, from Pin 1  $\overline{C4}$  .001uf Delete at Z2, from Pin 7  $\overline{R15}$  12K, R51 5K (VAR) R16 27K Delete at the junctions of CR12 and Q7, R25 250K (VAR)

#### CHANGE

R28 from a 1K Resistor to RC07GF222J R42 from a 2.2K Resistor to RC07GF472J R48 from a 3.3K, 1W Resistor to RC42GF152J R46 from a 2.2K Resistor to RC07GF472J R47 from a 1K Resistor to RC07GF392J Z2 from NW156 (UA709) to UA741

# A4939 (MOTHER BOARD)

Printed circuit board A4939 REF. CK2056-C, REF. DRAWING A4939

 ${\sf CK2056}$  must be used to perform the electrical modifications on this printed circuit board. The following components must be ADDED.

#### ADD

C19 .luf C20 .luf C21 5.5 uf (NP)

Add C19 (CC131-39)from connector
J101 Pin 14 to ground.
Add C20 (CC131-39)from connector
J102 Pin 9 to ground.
Add C21 (5.5uf Approx) CX118P5R5N3OC1 from XA102 connector socket
Pin (H) to ground.
Add a wire LWC26(7)U1 from connector socket J102 Pin 8 to connector
socket XA103 Pin K.
Add a wire LWC26(7)U1 from connector J101 Pin (H) to socket XA105
Pin (6).

TMC FORM SPEC 1

TMC SPECIFICATION			NO.					
REV:				Т				
COMPILED:	CHECKED:	APPD:	SHEET	6	OF	12		
TITLE:			JOHEET	0	OF	12		

# A4946 (A106)

5. Printed circuit board A4946 REF. CK2051-E, REF. DRAWING A4946

A4946 printed circuit board's schematic is part of CK2051-E.

CHANGE R1 1.5K to RC32GF332J

# A4945 (A107)

6. Printed circuit board A4945 REF. DWG. CK2051-E, REF. DRAWING A4945

A4945 printed circuit board's schematic part of CK2051-E.

CHANGE R1 1.5K to RC42GF272J

7. AX5175 (CONTROL UNIT)

CK2051-E must be used to perform the electrical modifications.

ADD K101 RL156-14 With Socket/Bracket CR104 1N645 RC32GF821J

REMOVE the wire from connector J103 Pin X to terminal 5 of T103.  $\overline{ADD}$  a No. 24 gauge (LWC24(7)U2) wire from J103 Pin X to K101 terminal 8  $\overline{ADD}$  a No. 24 guage (LWC24(7)U3) wire from K101 terminal 9 to T103 terminal 5.  $\overline{ADD}$  a Resistor (RC32GF821J) from K101 terminal 10 to ground.  $\overline{ADD}$  a Diode (1N645) across K101 terminals 1 and 4.  $\overline{ADD}$  a No. 24 guage (LWC24(7)U4) wire from K101 terminal 4 to connector socket J102 Pin 8.

Add a No. 24 gauge (LWC24(7)U5) wire from connector J104 - Pin Z to J102 Pin 15.

ADD a No. 24 gauge (LWC24(7)U6) wire from J104 Pin X toJJ101 Pin F. ADD a No. 24 gauge (LWC24(7)U7) wire from J104 Pin Y to J101 Pin H.

TMC FORM SPEC 1

2M 9.6K\_AIN

T	MC SPECIFIC	ATION	NO.			
REV:				П		
COMPILED:	CHECKED:	APPD:	SHEET	7	OF	12
TITLE:			Jones	,	O F	12

B, AX5176 (TUNER)

# 1, CAPACITOR ASSEMBLY (DRAWING AX5189)

Items 37, 43 and 45 must be removed and holes must be drilled and taped for a second set screw. This set screw must seat  $45^{\circ}$  apart from the existing set screw.

The 1K resistor (pot) which is seated on one of the gears and it's associated assembly must be removed. This is accomplished by removing (MS6464) the plate that holds this assembly in place. This will leave a  $1\frac{1}{4}$  inch hole and the two threaded nuts. At the wrom gear compartment a shaft extends (approx) 3/4 inch with a sleeve and two (2) set screws that act as a stop against two  $\frac{1}{2}$  inch terminals. Remove the sleeve and the two terminal stops, leaving a bare 3/4 inch shaft.

The gear stop assembly is to be assembled as per drawing AX5179 Detail "C". This assembly will seat in the vacated 1½ inch hole and fastened via two threaded nuts which were left vacated with the removal of the 1K resistor (pot) assembly. (All parts are supplied)

When Detail "C" is seated correctly and tightened, align the three (3) gears, tighten six (6) set screws two per gear and seal.

Important! Use "Glyptal" to seal (supplied).

At the worm gear compartment, assemble a RV4NAYSA102 pot as per AX5179Detail "D" (drawing and parts supplied)

# 2, COIL ASSEMBLY (DRAWING AX5178)

Items 29, 30 and 9 must be removed and holes must be drilled and taped for a second set screw. This set screw must seat 45° apart from the existing set screw.

The 1K Resistor (pot) which is seated on one of the gears and it's associated assembly must be removed. This is accomplished by removing (MS6464) the plate that holds this assembly in place. This will leave a  $1\frac{1}{4}$  inch hole and two threaded nuts. It may be necessary to remove the two (2) nuts if they seat on the inside of the metal work (facing the coil).

RV117-2-102 must now be re-assembled on MS6585, a detailed drawing of the entire assembly is supplied. Using AX5178, the parts supplied and the detailed drawing the assembly now can be completed and mounted in place. When the assembly is fastened securely, align the three (3) existing gears, tighten and seal with (Glyptal supplied).

TMC SPECIFICATION		NO.				
REV:						
COMPILED:	CHECKED:	APPD:	SHEET	8	OF	12
TITLE:						2/8/8

C,

MMX() REF. CK2067

If an MMX( ) Exciter is used in conjunction with an antenna tuning system (ATSA-3). The MMX( ) switching must be modified. Refer to CK2067 Sheet 2 of 2.

A note appears on CK2067 Sheet 2 of 2 defining the procedure that must be used for each series of transmitters (GPT) or (HFTA) series.

A wire may exist at pin Z of J119 this wire must be removed and soldered to pin P of J119. This operation is performed internal to the MMX() and will free pin Z.

A minimum amount of external wiring must be performed external to the units to ensure a proper systems operation. The following paragraph will deal with wiring on (HFTA) series transmitter and a (GPT) series transmitter.

#### (HFTA) SERIES TRANSMITTER

- a, Two wires must be added to the HFTA system to facilatate the ATSA-3 Modifications.
- 1, a wire LWC24(7)U4 from the connector that mates with J104 of the ATSA-3. (ATSA-3) J104-X to (MMX) J119-X (2. -2.999)
- 2, a wire LWC24(7)U5 from the connector that mates with J104 of the ATSA-3. (ATSA-3) J104-Y to (MMX) J119-Z (2.3-2.5999)

## b, (GPT) SERIES TRANSMITTER

Four wires must be added to the GPT system to facilatate the ATSA-3 Modifications. (Reference CA 1828 supplied)

1, a wire LWC24(7)U2 from the connector that mates with J104 of the ATSA-3.

(ATSA-3) J104-J to (TMA) Term 3 (RF Trig Monitor)

2, a wire LWC24(7)U3 from the connector that mates with J104 of the ATSA-3.


(ATSA-3) J104-Z to (TMA) Term 2 (FAULT)

3, a wire LWC24(7)U4 from the connector that mates with J104 of the ATSA-3.

(ATSA-3) J104-X to (MMX) J119-X (2.-2.999)

4, a wire LWC24(7)U5 from the connector that mates with J104 of the ATSA-3.

(ATSA-3) J104-Y to (MMX) J119-Z (2.3 - 2.5999)

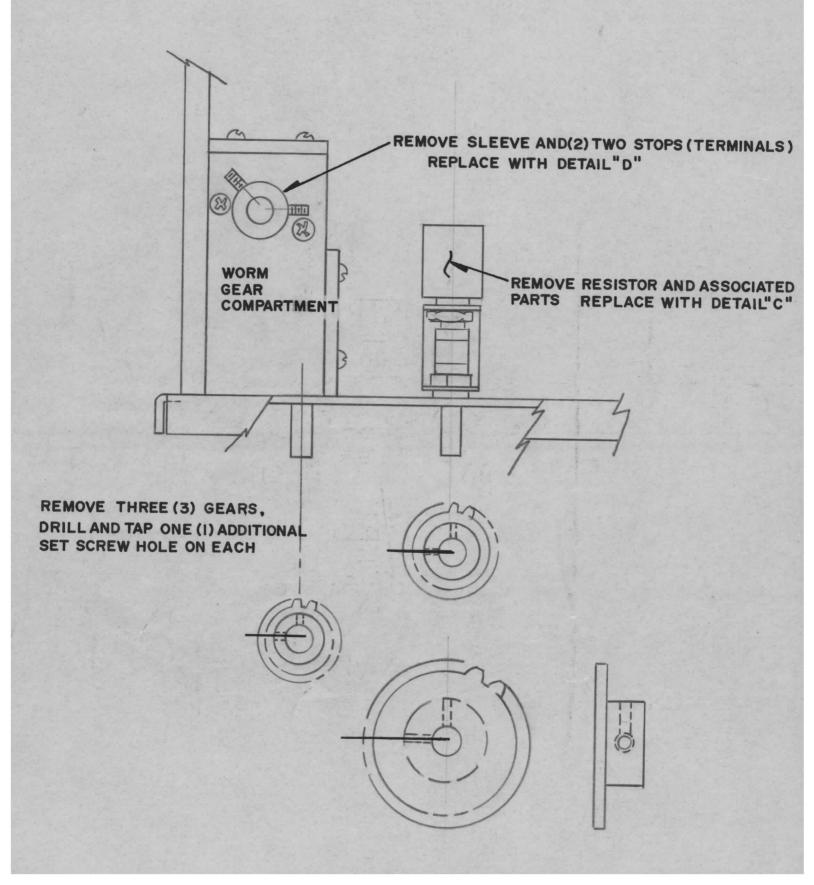

# AX5176 USED ON CAPACITOR ASSEMBLY PM515 PM519 FW37HBN P/0 MS6464 SM0832BN875 (2) P/O BBIOI -MS6464 BBIOI -LWEO8MRN-TE0832AE58H (2) FWO8HBN8 -MS6781 FW37HBN SCHH832BN6


- PM691FD2.00S

DETAIL"C"

USE EXSISTING GEAR

BB 117-5

# AX5176 USED ON CAR ASSEMBLY

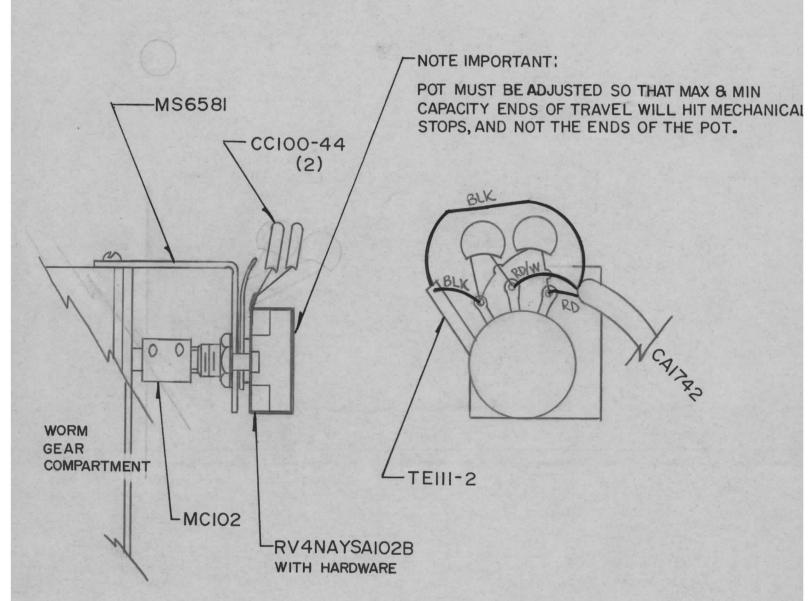

DETAIL "D"